

Date: Wednesday, 7/5/2006 2:42:30 PM
User: Kim Johnston

Process Sheet

Customer	: CU-DAR001 Dart Helicopters Services	Drawing Name	: 350/355 AS X-TUBE FWD
Job Number	: 27826		
Estimate Number	: 12485		
P.O. Number	: N/A	Part Number	: D350748101
This Issue	: 7/5/2006	S.O. No.	: N/A
Prsht Rev.	: NC	Drawing Number	: IIN D350-748 P5 PREL <i>06.07.05</i>
First Issue	: N/A	Project Number	: N/A
Previous Run	: 27825	Drawing Revision	: PREL
	Type : LANDING GEAR	Material	: N/A
Written By	: <i>[Signature]</i>	Due Date	: 7/30/2006
Checked & Approved By	: <i>[Signature]</i> <i>06.07.05</i>	Qty:	1 Um: Each
Comment	: Est Rev: A New Issue 06-07-05 JLM		

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
1.0	DC	DOCUMENT CONTROL
	Comment: Photocopy bluefile & type labels per PPPD350-748-101 CHG001 <i>KJ 06.10.02</i>	
2.0	27826A	X-TUBE AS 350/355 HI FWD
	Comment: Sub-Component X-TUBE AS 350/355 HI FWD ✓	
3.0	PACKAGING 1	PACKAGING RESOURCE #1
	Comment: PACKAGING RESOURCE #1 Pick Packing Kit	
4.0	D35001	350 SADDLE
	Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s) 350 SADDLE Batch: <i>B 28096</i> <i>is 2 are not eligible in computer system</i>	
5.0	D35011	BUSHING
	Comment: Qty.: 16.0000 Each(s)/Unit Total: 16.0000 Each(s) BUSHING Batch: <i>B 1128127</i> ✓	
6.0	AN46A	Bolt
	Comment: Qty.: 16.0000 Each(s)/Unit Total: 16.0000 Each(s) Bolt Batch: <i>M101418</i> ✓	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Mfg / Design Mgr	Approval QC Inspector

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Design Mgr	Approval QC Inspector
			Initial Design Mgr	Action Description Design Mgr	Sign & Date			

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

NOTE: Date & initial all entries

QA: N/C Closed: _____ Date: _____

Date: Wednesday, 7/5/2006 2:42:31 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350/355 AS X-TUBE FWD

Job Number: 27826

Part Number: D350748101

Job Number:



Seq. #:

Machine Or Operation:

Description :

7.0

AN441A

bolt



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

bolt

Batch: M101538 ✓

8.0

AN532A

Bolt



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Bolt

Batch: M101648 ✓

9.0

AN960JD416

Washer



Comment: Qty.: 32.0000 Each(s)/Unit Total : 32.0000 Each(s)

Washer

Batch: M19185 ✓

10.0

AN960JD516

Washer



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Washer

Batch: M101369 ✓

11.0

MS21042L4

Nut



Comment: Qty.: 24.0000 Each(s)/Unit Total : 24.0000 Each(s)

Nut

Batch: M19099 ✓

12.0

MS21042L5

Nut



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Nut

Batch: M101648 ✓

13.0

QC4

INSPECT 100% KITS FOR COMPLETENESS



Comment: INSPECT 100% KITS FOR COMPLETENESS

AB06/09/28

CC6/10/23 (1)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Mfg / Design Mgr	Approval QC Inspector

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Design Mgr	Approval QC Inspector
			Initial Design Mgr	Action Description Design Mgr	Sign & Date			

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes ☐ No ☒ DQA: D Date: 06/10/03

NOTE: Date & initial all entries

QA: N/C Closed: _____ Date: _____

Date: Wednesday, 7/5/2006 2:42:31 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350/355 AS X-TUBE FWD

Job Number: 27826

Part Number: D350748101

Job Number:



Seq. #:

Machine Or Operation:

Description :

14.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D350-748-101

Location: _____

PPP Rev: _____

DRIFT

See 14/10/03 ①

15.0

DC

DOCUMENT CONTROL



Comment: DOCUMENT CONTROL

Inspection Level 21

See 04/10/03 ①

Job Completion



See 06-10-03

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Mfg / Design Mgr	Approval QC Inspector

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Design Mgr	Approval QC Inspector
			Initial Design Mgr	Action Description Design Mgr	Sign & Date			

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

NOTE: Date & initial all entries

QA: N/C Closed: _____ Date: _____

3.10 Apply a continuous bead of Sikaflex-241/-291 or Proseal 890 or MIL-S-8802 Class B2 sealant in the following locations as per Figure 6:

- A) Along saddle/crosstube interface.
- B) Between the saddle flanges.
- C) Along saddle/skidtube interface.

4.0 WEIGHT AND BALANCE

The following weight and balance information is for Dart crosstube installations only. This data should be similar to the existing installation. Differences from the parts removed are the responsibility of the installer.

DART CROSSTUBE	FWD/AFT	WEIGHT	STA	MOMENT
D350-748-101	Fwd	35.2 lb (16.0 kg)	106.3 in (2.70 m)	3742 lb-in (43.2 kg-m)
D350-748-201	Aft	34.7 lb (15.7 kg)	162.4 in (4.12 m)	5635 lb-in (64.7 kg-m)

5.0 PARTS LIST

Qty -101	Qty -201	Part Number	Description
X		D350-748-101	CROSSTUBE INSTALLATION, AS 350/355 HIGH FWD
	X	D350-748-201	CROSSTUBE INSTALLATION, AS 350/355 HIGH AFT
1		D350-748-141	CROSSTUBE ASSEMBLY, AS 350/355 HIGH FWD
	1	D350-748-241	CROSSTUBE ASSEMBLY, AS 350/355 HIGH AFT
*2	*2	D3502-1	SUPPORT
*2	*2	D2856-400-710	ABRASION STRIP
*1	*1	AELS-1032-225	INSERT
*2	*2	MS21920-20	CLAMP
*1	*1	MS27039-1-10	SCREW
*1	*1	AN960JD10	WASHER
4	4	D3500-1	SADDLE
16	16	D3501-1	BUSHING
16	16	AN4-6A	BOLT
8	8	AN4-41A	BOLT
4	4	AN5-32A	BOLT
32	32	AN960JD416	WASHER
8	8	AN960JD516	WASHER
24	24	MS21042L4	NUT (OR MS21042-4)
4	4	MS21042L5	NUT (OR MS21042-5)

* REFERENCE ONLY. PARTS ARE INCLUDED IN D350-748-141/241 ASSEMBLIES ABOVE

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 27826

Date: Wednesday, 7/5/2006 2:42:45 PM
User: Kim Johnston

Process Sheet

Customer	: CU-DAR001 Dart Helicopters Services	Drawing Name	: X-TUBE AS 350/355 HI FWD
Job Number	: 27826A		
Estimate Number	: 12484		
P.O. Number	: <i>N/A</i>	Part Number	: D350748141
This Issue	: 7/5/2006	S.O. No.	: <i>N/A</i>
Prsht Rev.	: NC	Drawing Number	: D350-748-141 PREL
First Issue	: <i>N/A</i>	Project Number	: N/A
Previous Run	: 27825A	Drawing Revision	: PREL
	Type : LANDING GEAR	Material	: <i>N/A</i>
Written By	: <i>[Signature]</i>	Due Date	: 7/30/2006
Checked & Approved By	: <i>[Signature]</i>	Qty:	: 1 Um: Each
Comment	: Est Rev:A New Issue 06-07-05 JLM		

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

1.0	DC	DOCUMENT CONTROL
-----	----	------------------



Comment: DOCUMENT CONTROL

Photocopy bluefile and create labels as per PPP D350-748-141 CHG001

KS 06 10 02

2.0	D6017115	Crosstube Material
-----	----------	--------------------



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Crosstube Material

D6017-115

2.339" OD X 2.000" ID

Batch: *B27318**YML 06/07/14**[Signature]*

3.0	MORI SEIKI	MORI SEIKI CNC LATHE LARGE
-----	------------	----------------------------



Comment: MORI SEIKI CNC LATHE LARGE

1-Fill tube with sand & install plugs DT *N/A* on both ends as per Folio FA648

2-Turn first side as per Folio FA648

3-Deburr & Inspect for surface damage. Repair damage within limits as per Dwg D350-748-141.

YML 06/07/14

4.0	QC1	INSPECT ALL DIM TO DIM SHEET
-----	-----	------------------------------



Comment: INSPECT ALL DIM TO DIM SHEET

YML 06/07/14

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Mfg / Design Mgr	Approval QC Inspector

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Design Mgr	Approval QC Inspector
			Initial Design Mgr	Action Description Design Mgr	Sign & Date			
06.09.17	3	Taper machined does not match drug at some locations	CP 06.09.17 per QSI 042	Part is OK PER ATTACHED DS EMAIL	per 06-07-14	06-09-02	CP 06.09.17 per QSI 042	06-09-07

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes ☒ No ☐ DQA: ☒ _____ Date: 06/10/03

NOTE: Date & initial all entries QA: N/C Closed: _____ Date: _____

Date: Wednesday, 7/5/2006 2:42:45 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: X-TUBE AS 350/355 HI FWD

Job Number: 27826A

Part Number: D350748141

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

5.0	MORI SEIKI	MORI SEIKI CNC LATHE LARGE
-----	------------	----------------------------



Comment: MORI SEIKI CNC LATHE LARGE

1-Turn second side as per Folio FA648

2-Deburr & Inspect for surface damage. Repair damage within limits as per Dwg D350-748-141.

ml 06/07/14

6.0	QC1	INSPECT ALL DIM TO DIM SHEET
-----	-----	------------------------------



Comment: INSPECT ALL DIM TO DIM SHEET

ml 06/07/14

7.0	QC8	SECOND CHECK
-----	-----	--------------



Comment: SECOND CHECK

SG 06.07.16

8.0	OUTSIDE SERVICE	OUTSIDE SERVICES
-----	-----------------	------------------



Comment: Sub-Contracting OUTSIDE SERVICES

Issue P/O: *1709*
Heat Treat to min 180 KSI As per Dwg D350-748-141
Sand Blast tube after Heat Treat
Possible Supplier: Vac Aero
Ensure Certificate of Conformity is attached

u 06.07.18

9.0	PACKAGING 1	PACKAGING RESOURCE #1
-----	-------------	-----------------------



Comment: PACKAGING RESOURCE #1

Receive & Inspect For Transit Damage
Ensure certificate of conformity is attached

RB 06/07/31 10(1)

10.0	QC6	DIMENSIONAL CHECK
------	-----	-------------------



Comment: DIMENSIONAL CHECK

RB 06.09.06



11.0	BENDING	BENDING MACHINE
------	---------	-----------------



Comment: BENDING MACHINE




Bend tube as per Dwg D350-748-141 using CNC bender program *NA* and Folio FT *NA*

Barryson

u.1 QC 6 dim-check

06.09.07

(PTU)

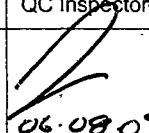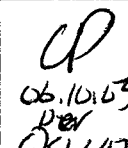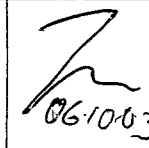W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Mfg / Design Mgr	Approval QC Inspector	
060809	11.1	QC 6 dim check before drilling Perm. change					 06.08.09	
061003	14	CAD Plate and Magnetic Particle Inspect per DS Dwg D36-74841 Rev.C. Acceptable to CAD plate to spec AMS-QQP-41613 See attached DS email				 06.10.03 per Q51642	 06.10.03	

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Design Mgr	Approval QC Inspector
			Initial Design Mgr	Action Description Design Mgr	Sign & Date			

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

NOTE: Date & initial all entries

QA: N/C Closed: _____ Date: _____

Date: Wednesday, 7/5/2006 2:42:46 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: X-TUBE AS 350/355 HI FWD

Job Number: 27826A

Part Number: D350748141

Job Number:



Seq. #:

Machine Or Operation:

Description :

12.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Remove all marks from tube within limits of D350-748-141

DP 6-8-21

2-Drill Tube as per Dwg D350-748-141

DP 6-8-28

3-Deburr

DP 6-8-28

4-Engrave Part # and Batch # as per Dwg D350-748-141

Direct Seq. #5

13.0

QC6

DIMENSIONAL CHECK

QL5



260907 (1)



Comment: DIMENSIONAL CHECK

14.0

OUTSIDE SERVICE

OUTSIDE SERVICES



Comment: Sub-Contracting OUTSIDE SERVICES

Liquid Penetrant Inspection as per QSI 038

Issue P/O: 2000

LPI as per ASTM 1417 Level 2

Attach copy of NDT results to work order

260911 (1)

PTO →

15.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Inspect for transit damage Ensure copy of NDT results attached to work order.

260928

16.0

QC6

DIMENSIONAL CHECK



260928 (1)



Comment: Inspect for damage & ensure results are as per Dwg D350-748-241

17.0

SPRAY PAINTING

SPRAY PAINTING



Comment: SPRAY PAINTING

1-Prime inside crosstube as per QSI 005 4.2

PRIME OUTSIDE OF CROSS TUBE PER QSI 005 4.2

MM 060928 (1)

260925

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Mfg / Design Mgr	Approval QC Inspector	
06.09.25	17 19	PRIME INSIDE & OUTSIDE OF CROSSRUBER THEN PAINT OUTSIDE PER QSI 65 4.2 PER DSSO-748-141 Rev.C	MM	06.09.28	①	UP 06.09.25 Pw QSI 642	J 06.10.03	
06.10.03	27	Grinding wire hole 0.090" too far inboard. This is acceptable for this crossruber				UP 06.10.03 Pw QSI 042	J 06-10-03	

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Design Mgr	Approval QC Inspector
			Initial Design Mgr	Action Description Design Mgr	Sign & Date			

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

NOTE: Date & initial all entries

QA: N/C Closed: _____ Date: _____

Date: Wednesday, 7/5/2006 2:42:46 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: X-TUBE AS 350/355 HI FWD

Job Number: 27826A

Part Number: D350748141

Job Number:



Seq. #:

Machine Or Operation:

Description :

18.0

QC14

Inspect Spray Paint



Comment: Inspect Spray Paint

Then, Wrap in plastic bag to protect from scratches

N/A 2

19.0

POWDER COATING

PAINT

POWDER COATING



Comment: POWDER COATING

Powder Coat White Gloss (Ref: 4.3.5.1) as per QST 005-4.3

PAINT OUTSIDE OF CRUSTUBE PER QST 005 4.2

UP 06.09.25

MT 06-09-28

(1)

20.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION

QC14



06-09-29



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

PAINT

21.0

D35021

SUPPORT



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

SUPPORT

Batch: 27874

2T 06-09-29

22.0

D2856400

Abrasion Strip



Comment: Qty.: 1.2401 f(s)/Unit Total: 1.2401 f(s)

Abrasion Strip 7.10" long x2

Batch: 27545

2T 06-09-29

23.0

ALS41032225

Insert



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Insert

Batch: 100489

2T 06-09-29

24.0

AN960JD10

Washer



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Washer

Batch: 100743

2T 06-09-29

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Mfg / Design Mgr	Approval QC Inspector

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Design Mgr	Approval QC Inspector
			Initial Design Mgr	Action Description Design Mgr	Sign & Date			

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes ☒ No ☐ DQA: ☒ Date: 06/10/03

NOTE: Date & initial all entries

QA: N/C Closed: _____ Date: _____

Date: Wednesday, 7/5/2006 2:42:46 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: X-TUBE AS 350/355 HI FWD

Job Number: 27826A

Part Number: D350748141

Job Number:



Seq. #:

Machine Or Operation:

Description :

25.0

MS2192020

Clamp (per MIL-DTL-8783C)



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Clamp (per MIL-DTL-8783C)

Batch: 15436

27 06-09-29

26.0

MS35206344

MS27039-1-10

Screw



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Screw

Batch: 18836

27 06-09-29

27.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Install Ground wire Insert, then insert screw and washer

2-Install Abrasion strips as per Dwg D350-748-141 & QSI 035.

3-Install supports as per Dwg D350-748-141, Torque to 60-80 IN-LBS

27 06-10-02

28.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

29.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D350-748-241

Location:

PPP Rev:

NP 10/6/10/03

30.0

DC

DOCUMENT CONTROL



Comment: DOCUMENT CONTROL

Inspection Level 21

06/10/03

Job Completion



POSITIVE RECALL





EFFECTIVE

RELEASED

AUTH

DATE

Verification of parts
Verification of labels

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Mfg / Design Mgr	Approval QC Inspector	
06-10-03	27.4	Apply LPS procyon to the inside of walls of the x-tubes, using A saturated sponge. Qty: <u>AIR</u> Batch: <u>M17168</u> Add step this w/o only	FC	06-10-03		 06-10-03	 06-10-03	
06-10-03		Add LPS procyon as per above instructions after QCS At step 28.0, and followed by a QCS. Add to Diag. Permanent change				 06-10-03	 06-10-03	

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Design Mgr	Approval QC Inspector
			Initial Design Mgr	Action Description Design Mgr	Sign & Date			

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

NOTE: Date & initial all entries

QA: N/C Closed: _____ Date: _____

PRELIMINARY ISSUE

DESIGN 92	DRAWN BY	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED	APPROVED	DRAWING NO. D350-748-141	REV. B SHEET 1 OF 3
DATE 06.06.30		TITLE CROSSTUBE (AS 350/355 HI FWD) SCALE NTS	
A	06.03.31	NEW ISSUE	
B	06.06.30	ADD D6017-115 & PRIME AND PAINT	

QTY	P/N	DESCRIPTION
X	D350-748-141	CROSSTUBE ASSEMBLY (AS 350/355 HI FWD)
1	D6017-115	CROSSTUBE (OR D6015-125)
2	D3502-1	SUPPORT
2	D2856-400-710	ABRASION STRIP
1	AELS-1032-225	INSERT
1	AN960JD10	WASHER
2	MS21920-20	CLAMP
1	MS35206-344	SCREW


D350-748-141 CROSSTUBE:

- 1) MATERIAL: MANUFACTURED FROM D6017-115 OR D6015-125
FINISHED LENGTH = 110.27±0.06
- 2) MACHINE PER MACHINING DETAIL ON PAGE 3. BLEND OUT ALL EDGES FROM MACHINING LONGITUDINALLY. TRANSITIONS SHOULD BE SMOOTH. NOTE: ALL HOLES ARE DRILLED AFTER BENDING.
- 3) SCRIBE DART PART NUMBER AND BATCH NUMBER IN THIS AREA WITH VIBRATING STYLUS.
- 4) BEND PROGRESSIVELY WITH A MINIMUM OF 7 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D.
- 5) HEAT TREAT TO MIN. 180 KSI/ PER MIL-T-6736 AFTER TURNING
- 6) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 7) FINISH: POWDER COAT WHITE (4.3.5.2) OUTSIDE PER DART QSI 005 4.3.
PRIME INSIDE PER DART QSI 005 4.2.
OR
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 8) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE. WHEN DRILLING HOLES EXTREME CARE MUST BE TAKEN AND CAREFUL DEBURRING PERFORMED TO ENSURE A CLEAN HOLE WITH NO CRACKING/CHIPPING/GROOVES.
- 9) INSTALL D2856-400-710 ABRASION STRIP WITH A GAP ON BOTTOM SIDE OF CROSSTUBE, CENTERED OPPOSITE D3502-1 SUPPORT, PER QSI 035.
- 10) TORQUE MS21920-20 CLAMPS 60 TO 80 IN-LB
- 11) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 12) ALL DIMENSIONS ARE IN INCHES
- 13) PART IS SYMMETRIC ABOUT CENTERLINE EXCEPT FOR Ø0.297 HOLE.


SHOP COPY
RETURNING
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 27826A

Copyright © 2006 by DART AEROSPACE LTD


THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

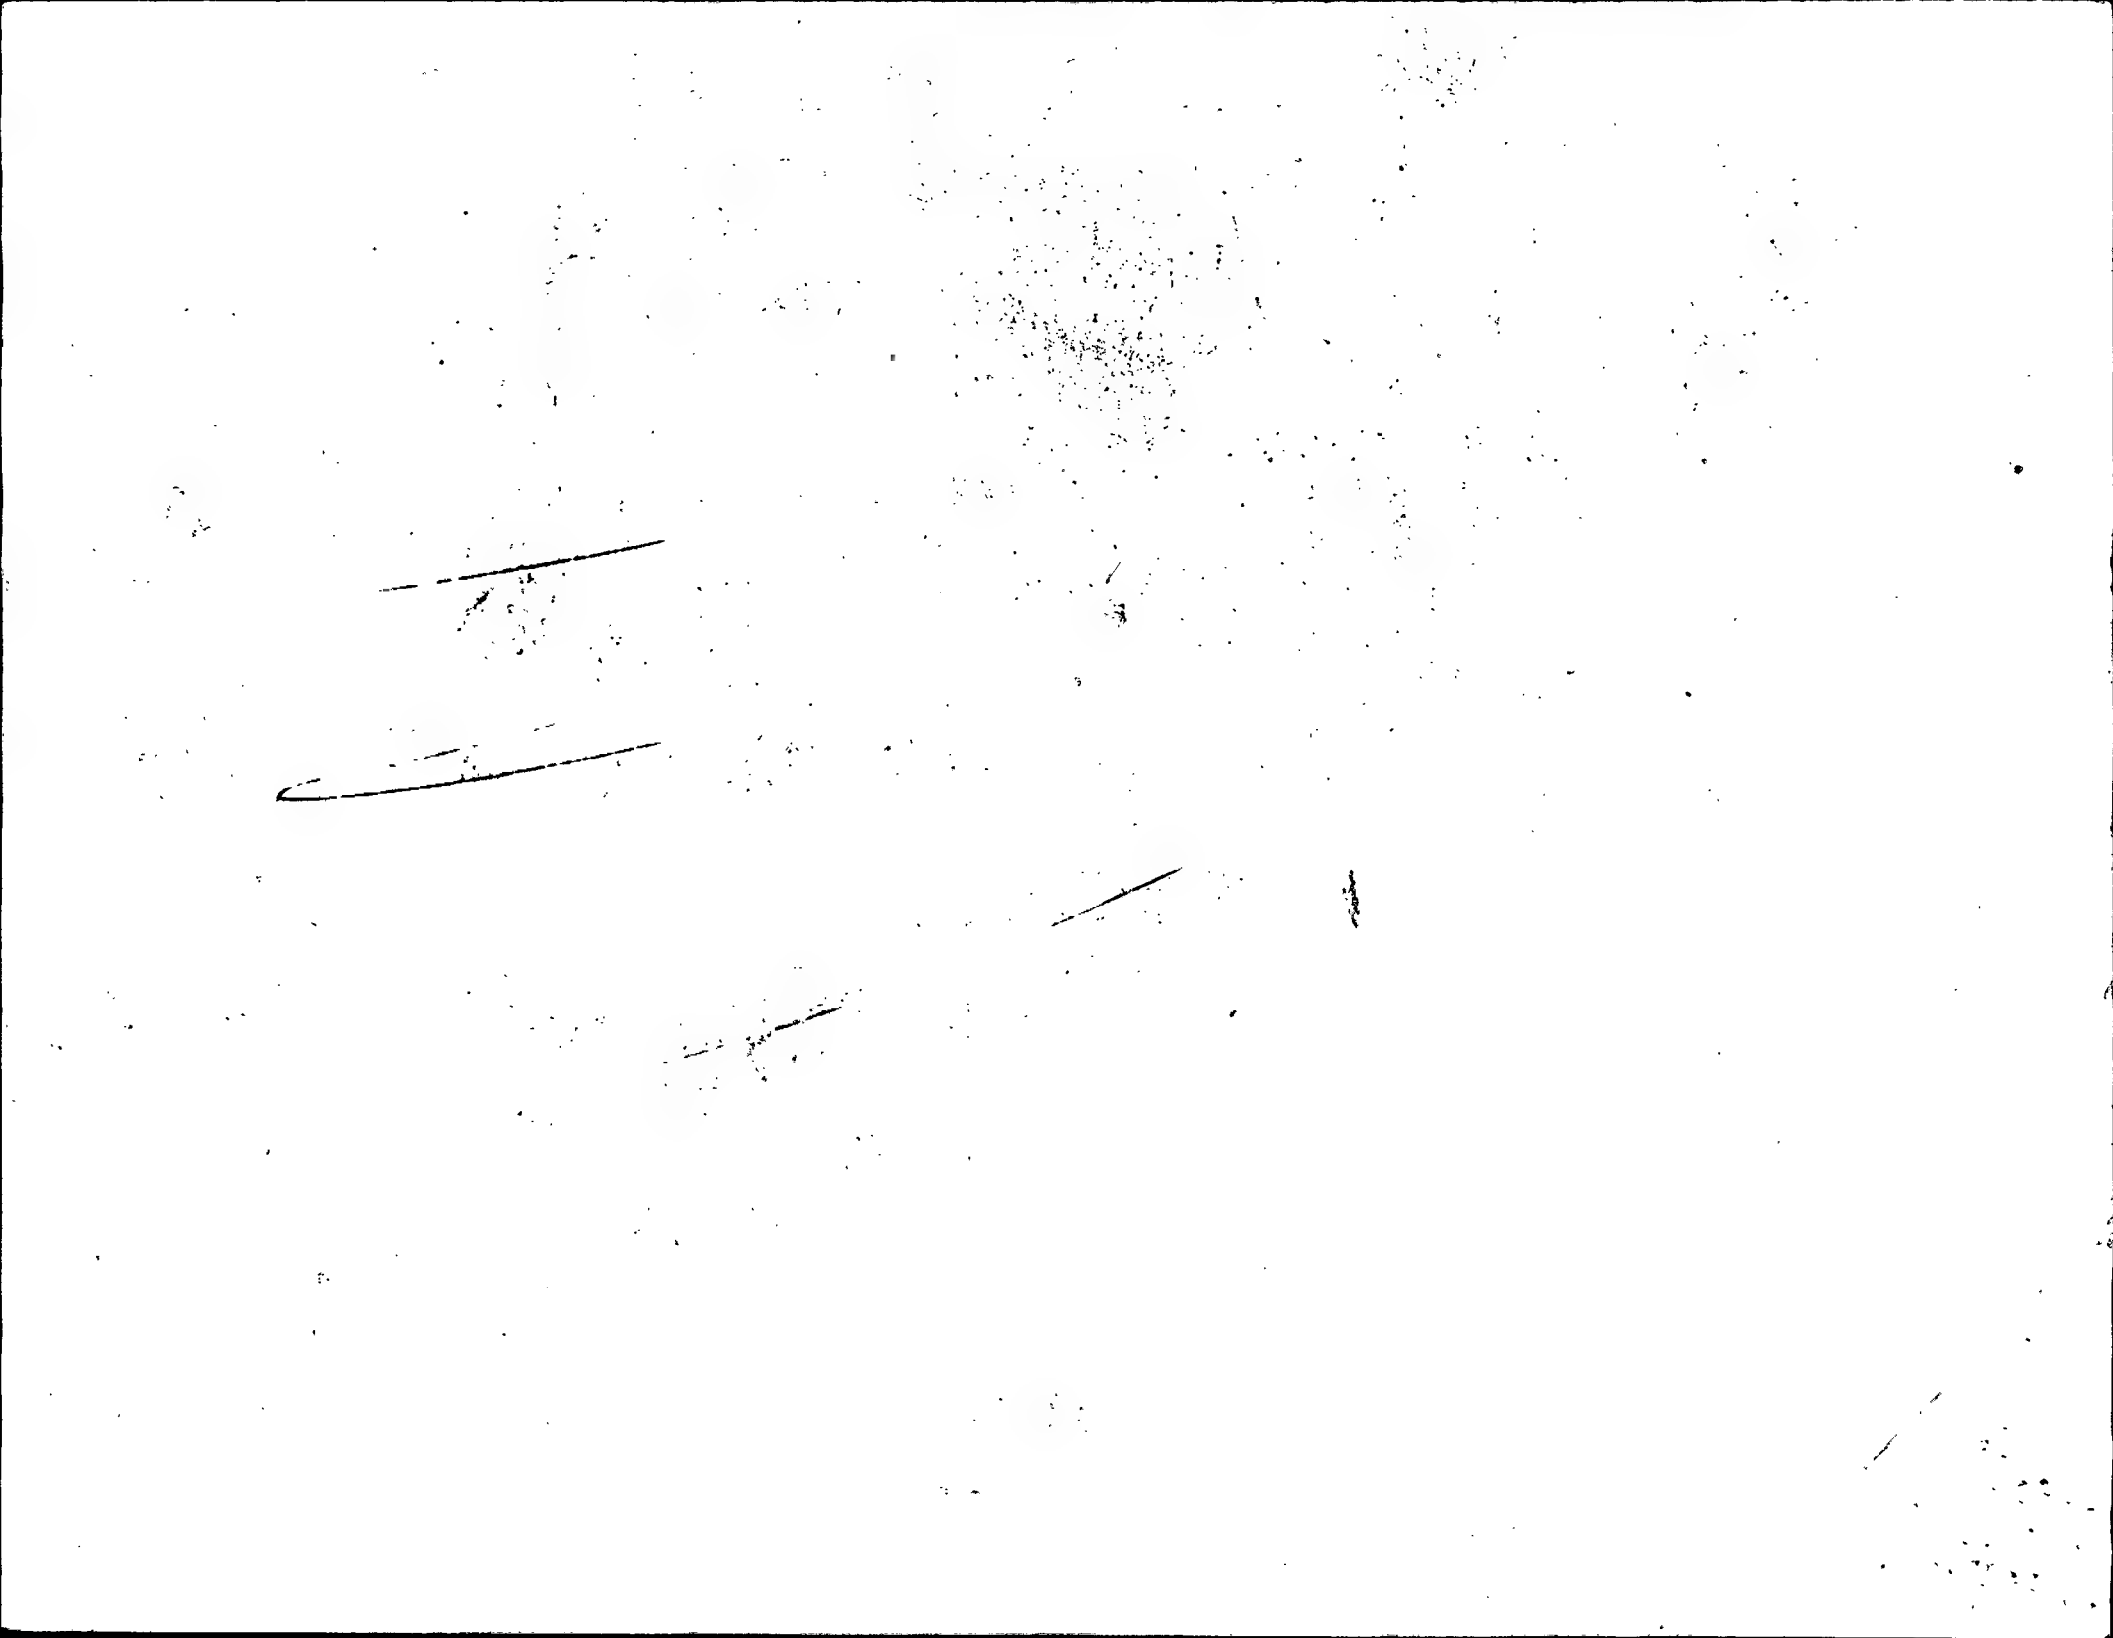


PRELIMINARY ISSUE

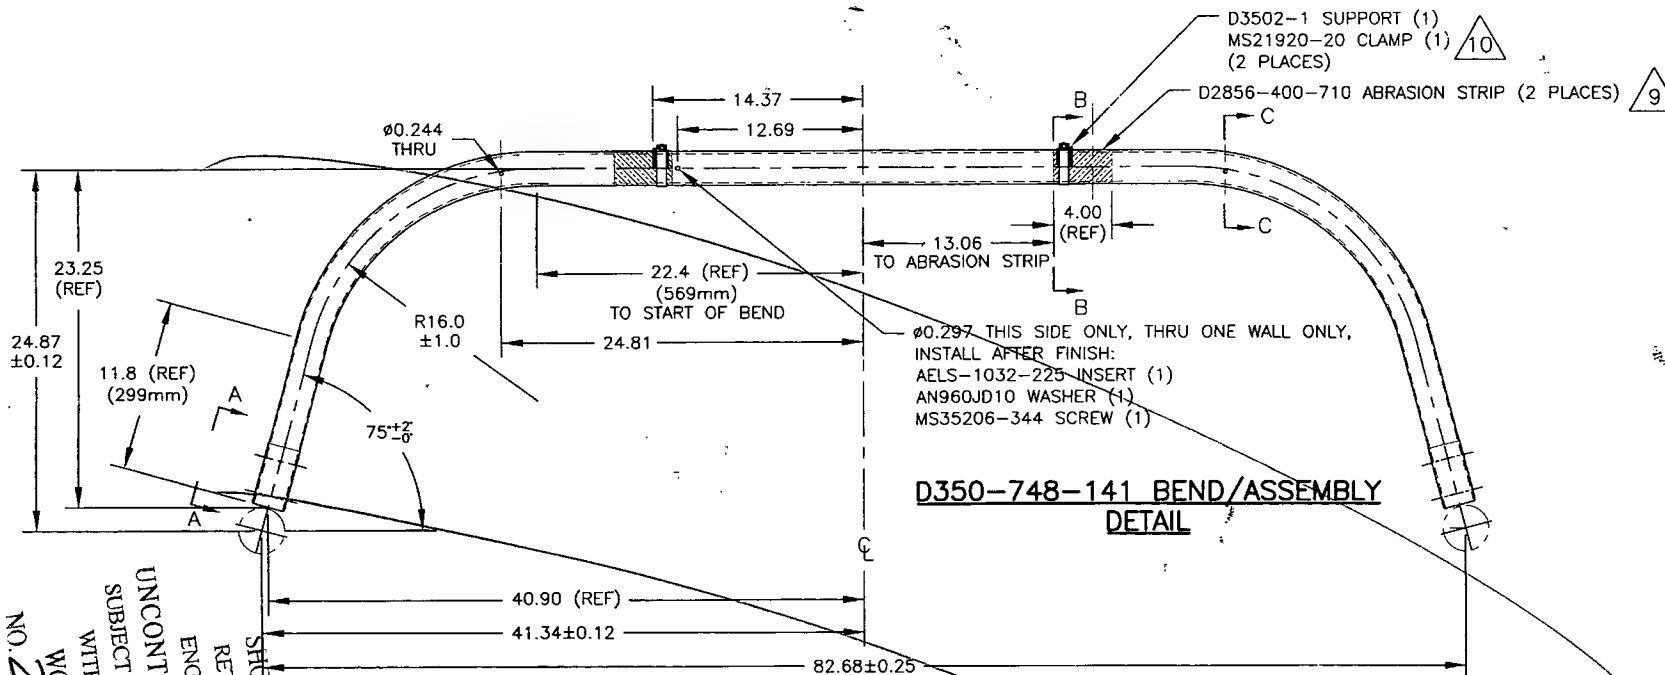


SECTION B-B
SCALE 1:2

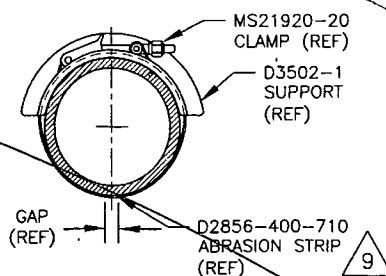

SECTION C-C
SCALE 1:2

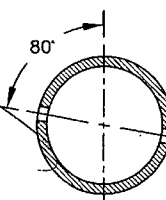



VIEW A-A
SCALE 1:2

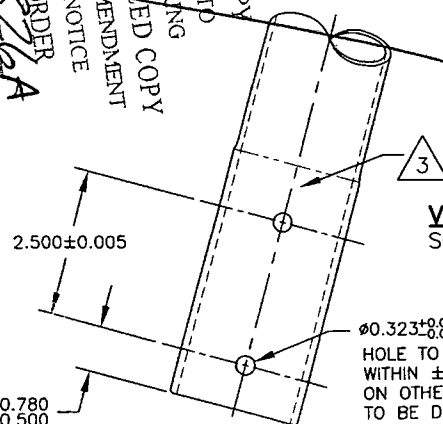

COPYRIGHT © 2006 BY DART AEROSPACE LTD.		DESIGN	q	DRAWN BY		DART	DART AEROSPACE LTD. HARRISBURG, ONTARIO, CANADA
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.		CHECKED		APPROVED		DRAWING NO. D350-748-141	REV. B SHEET 2 OF 3
		DATE	06.06.30	TITLE		CROSSTUBE (AS 350/355 HI FWD)	SCALE 1:8

NO. 27826A
WORK ORDER
SUBJECT TO AGREEMENT
WITHOUT NOTICE
UNCONTROLLED COPY
ENGINEERING
RETURN TO
SHOP COPY

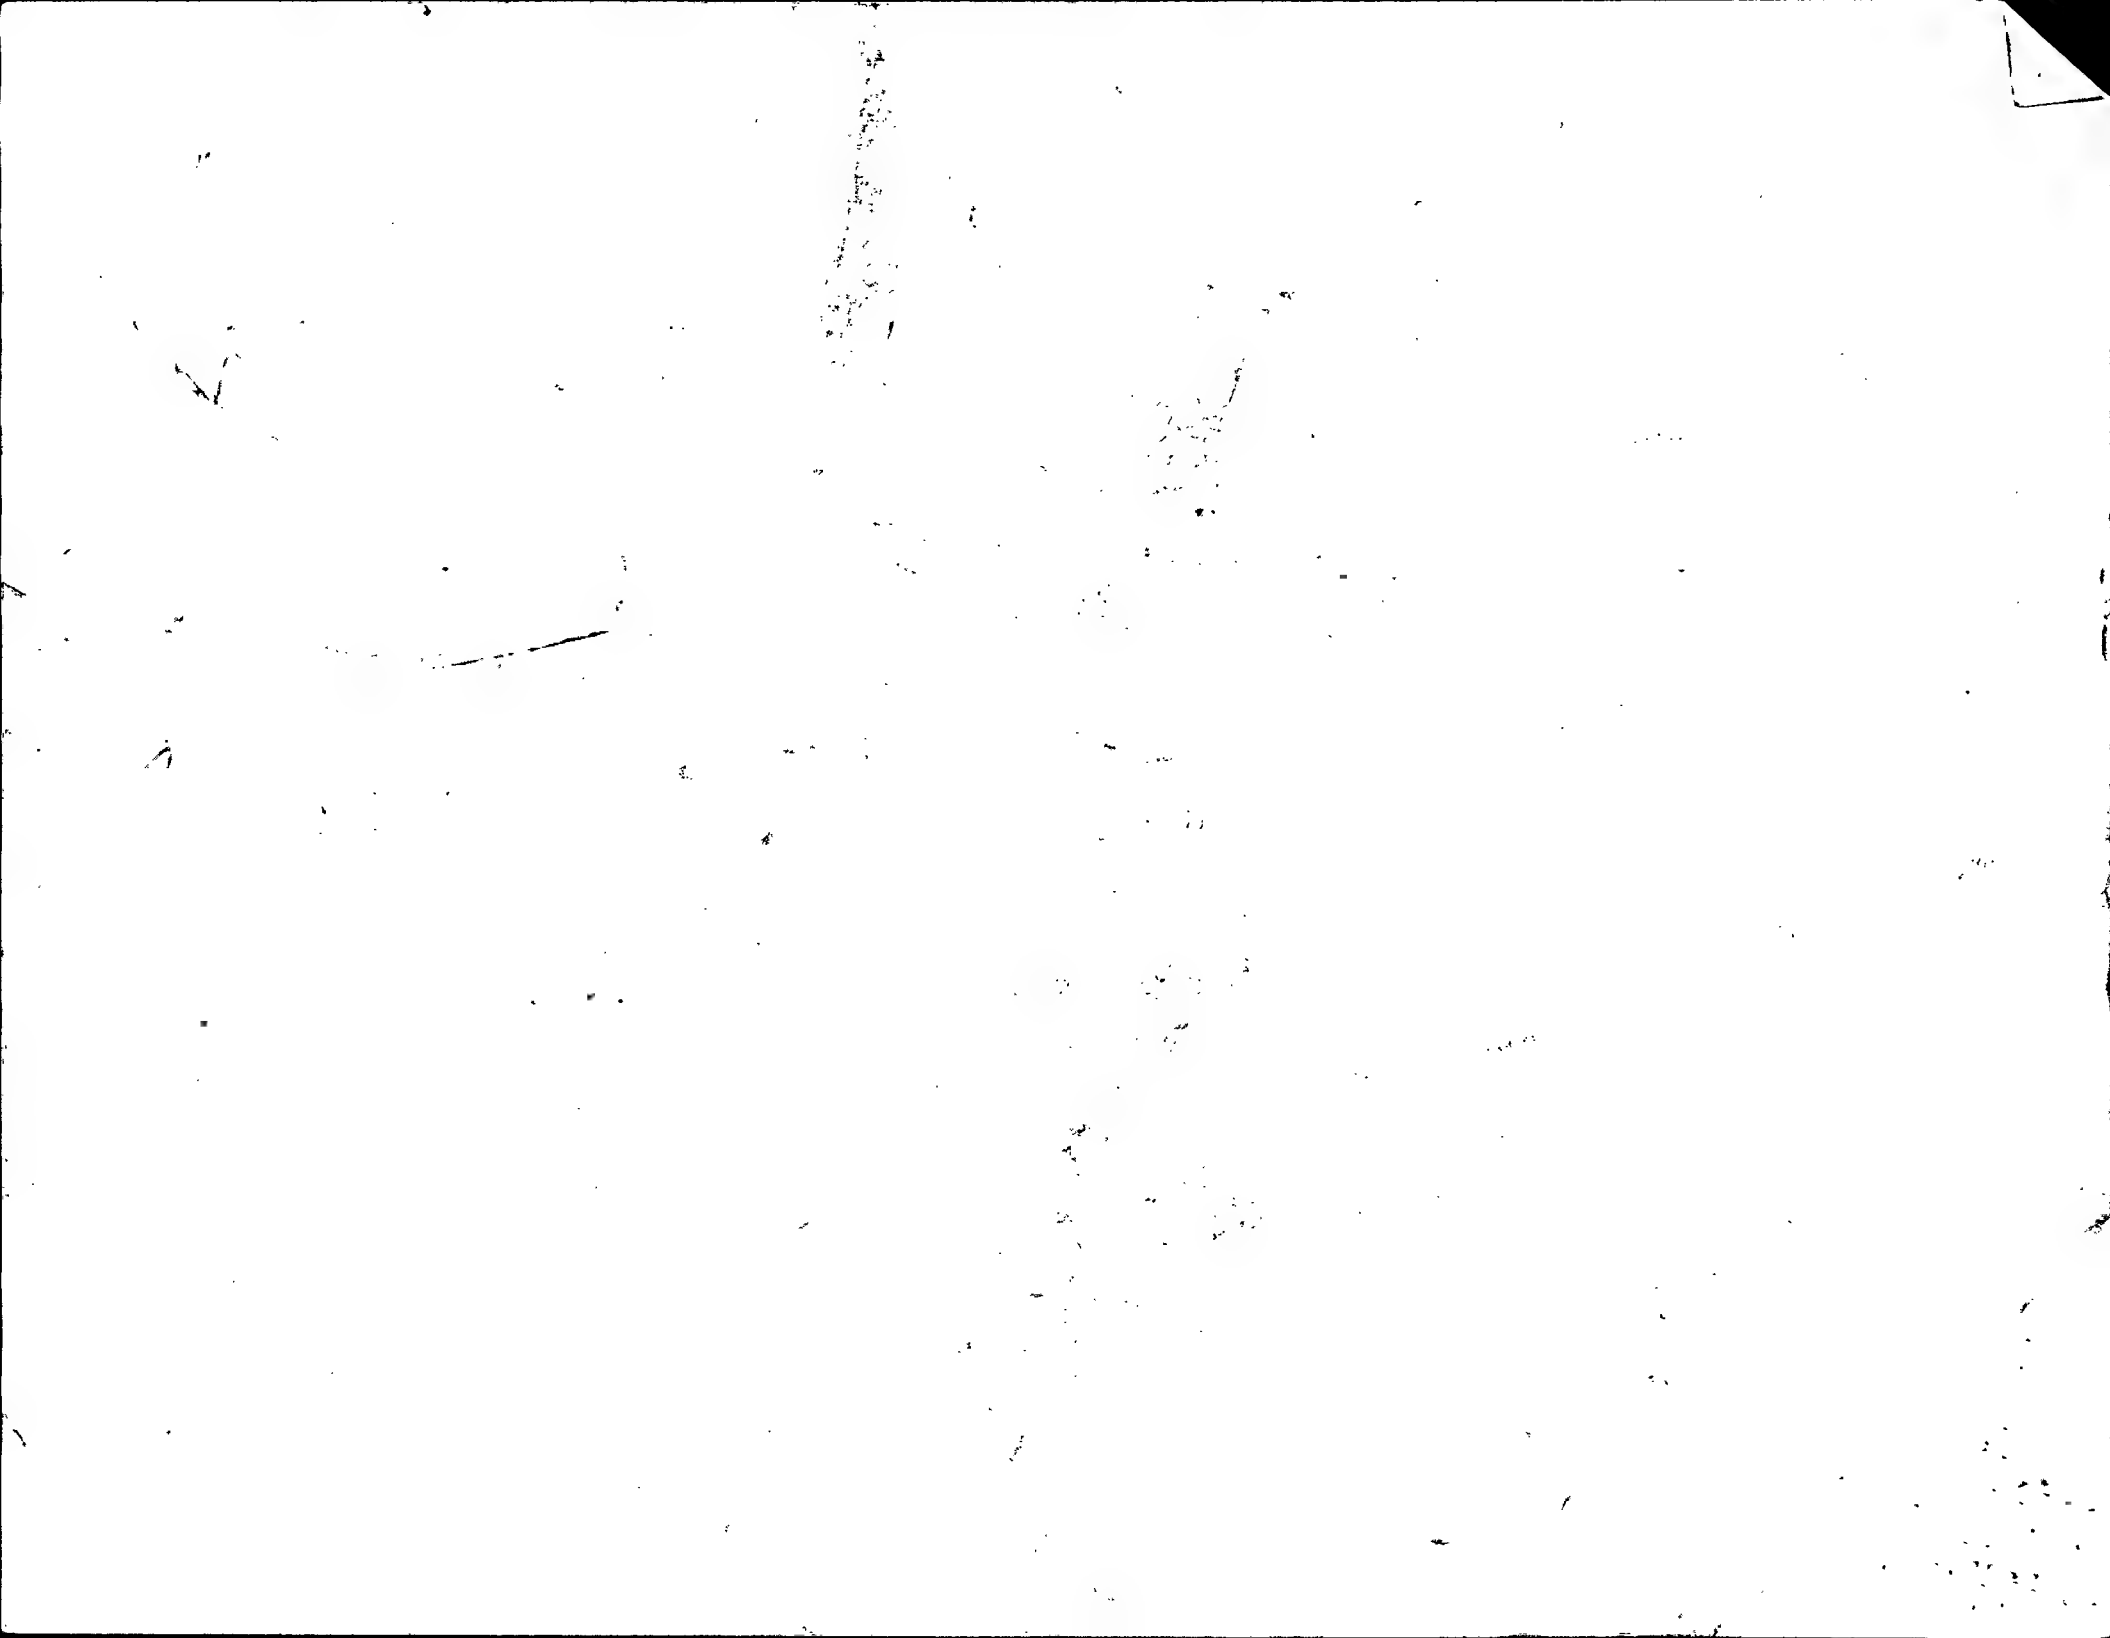


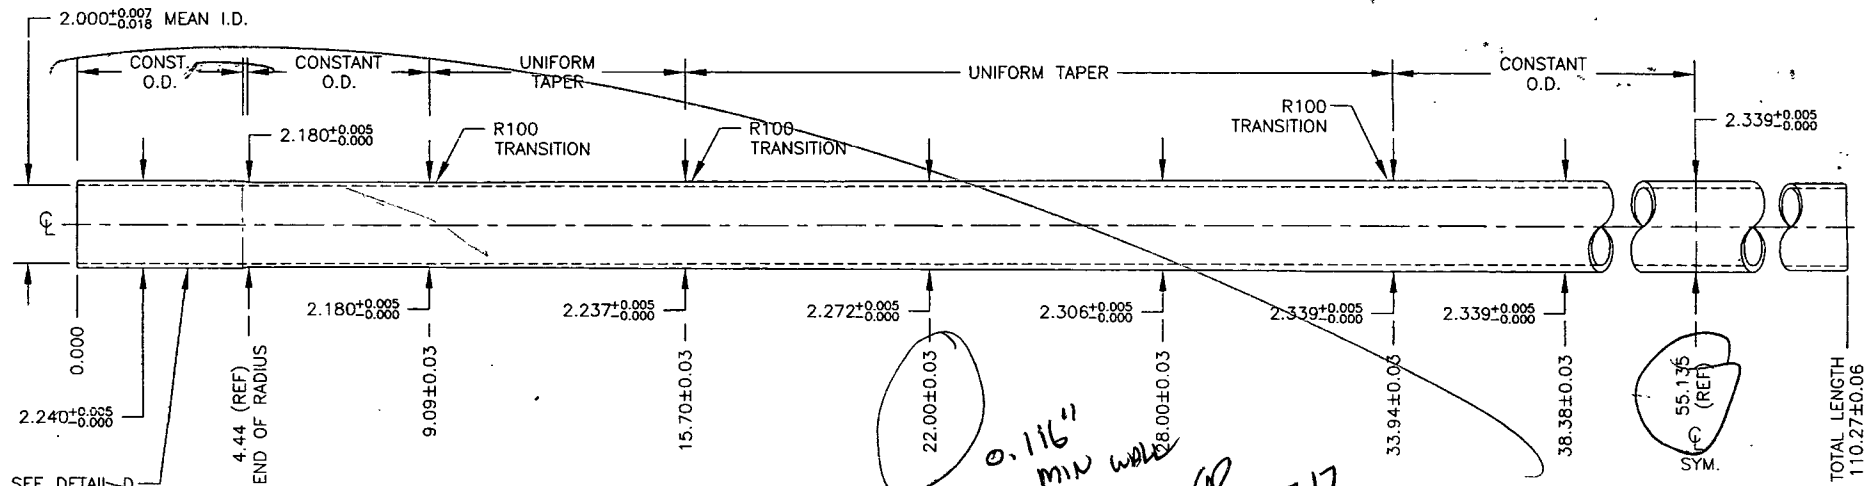


D350-748-141 MACHINING DETAIL

0.116" MIN WALL
06.07.17

0.150" MIN WALL

DETAIL D: CUFF SCALE 1:1

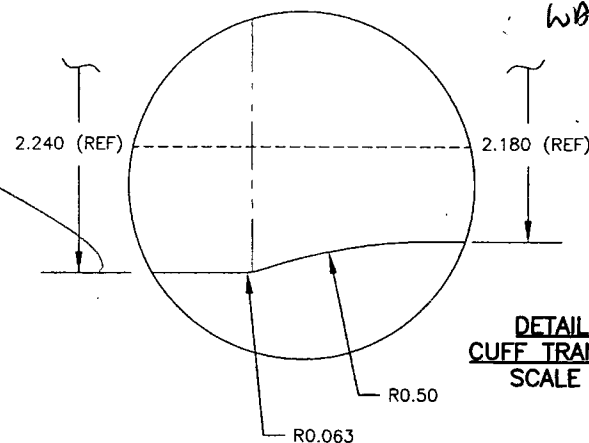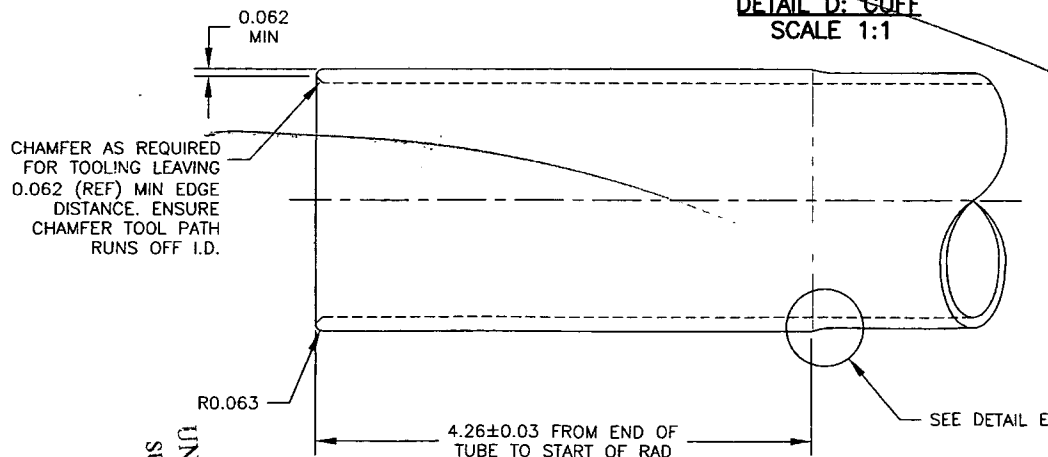

DETAIL E: CUFF TRANSITION SCALE 9:1

PRELIMINARY ISSUE

NO. 278226 A
WORK ORDER
SUBJECT TO AMENDMENT
WITHOUT NOTICE
UNCONTROLLED COPY
ENGINEERING
RETURN TO
SHOP COPY

COPYRIGHT © 2004 BY DART AEROSPACE LTD.		DESIGN	DRAWN BY	DART DART AEROSPACE LTD. HAWKESBURY, ONTARIO, CANADA	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.		06.06.30	06.06.30	D350-748-141	REV. B SHEET 3 OF 3
DATE		TITLE		CROSSTUBE (AS 350/355 HI FWD)	
06.06.30		1:3			

DART AEROSPACE LTD		Work Order: 27926A
Description: 35 CROSS TUBE 350 FWD		Part Number: D 350-798-141
Inspection Dwg: p	Rev: B	Page 1 of 1


FIRST ARTICLE INSPECTION CHECKLIST

☒ First Article ☒ Prototype

Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
0.062	$\pm .010$	0.063	—			
4.26	$\pm .030$	4.270	—			
2.240	$\pm .005$	2.242	—			
2.180	$\pm .005$	2.183	—			
2.180	$\pm .005$	2.185	—			
2.237	$\pm .005$	2.242	—			
2.272	$\pm .005$	2.276	—			
2.306	$\pm .005$	2.310	—			
2.339	$\pm .005$	2.340	—			-0.001"
2.339	$\pm .005$	2.340	—			
110.27	$\pm .060$	110.28	—			
0.062	$\pm .010$	0.063	—			Centre 2.339
4.26	$\pm .030$	4.280	—			15-0.002"
2.240	$\pm .005$	2.240	—			-0.001"
2.180	$\pm .005$	2.183	—			-0.001"
2.180	$\pm .005$	2.184	—			
2.237	$\pm .005$	2.242	—			
2.272	$\pm .005$	2.275	—			
2.306	$\pm .005$	2.309	—			
2.339	$\pm .005$	2.340	—			-0.001"
2.339	$\pm .005$	2.341	—			

Measured by: <i>JML</i>	Audited by: <i>BL</i>	Prototype Approval:
Date: 06/07/14	Date: 06.07.16	Date:

Rev	Date	Change	Revised by	Approved
A		New Issue	KJ/JLM	

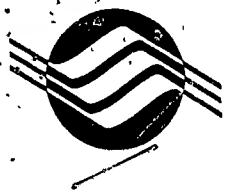

VAC AERO
INTERNATIONAL INC.

284

PACKING SLIP

OAK 77605-1

07/28/2006

MM/DD/YYYY

PAGE: 1



HEAD OFFICE
1371 SPEERS ROAD, OAKVILLE, ONTARIO
CANADA L6L 2X5
TEL: (905) 827-4171 FAX: (905) 827-7489



QUEBEC DIVISION
7450 RUE VÉRITÉ STREET, ST LAURENT, QUÉBEC
CANADA H4S 1C5
TEL: (514) 334-4240 FAX (514) 334-6269

GST No.: R105468102

1DAR01

BILL TO: DART AEROSPACE LTD.
1270 ABERDEEN ST.
HAWKESBURY, ON

SHIP TO: DART AEROSPACE LTD.
1270 ABERDEEN ST.
HAWKESBURY, ON

K6A 1K7

K6A 1K7

DATE SHIPPED	SHIP VIA	F.O.B.
07/28/2006		ORIGIN
CUSTOMER P/O No.	JOB No.	TERMS
1709		COD

LN	PART NO	DESCRIPTION	UOM	QTY ORDERED	QTY SHIPPED	B/O QTY
01	D350-CROSS TUBES		EA	8	8	0
		Process Specifications: Procedure: 4353 HEAT TREATED TO 180-200 KSI PER AMS 2759-1C MATERIAL: 4130 D350-748-141 B27823A, B27824A, B27825A, B27826A D350-748-241 B27830A, B27829A, B27827A, B27828A NOTE: SAND BLAST TUBES				
02	LC	LOT CHARGE 320LBS X \$2.26/LB		1	1	0


No claims for shortage in weight or count will be entertained, unless presented within 5 working days after receipt of materials by customer.



VACUUM BRAZING HEAT TREATING SPECIAL PROCESSING FURNACE EQUIPMENT



HEAT

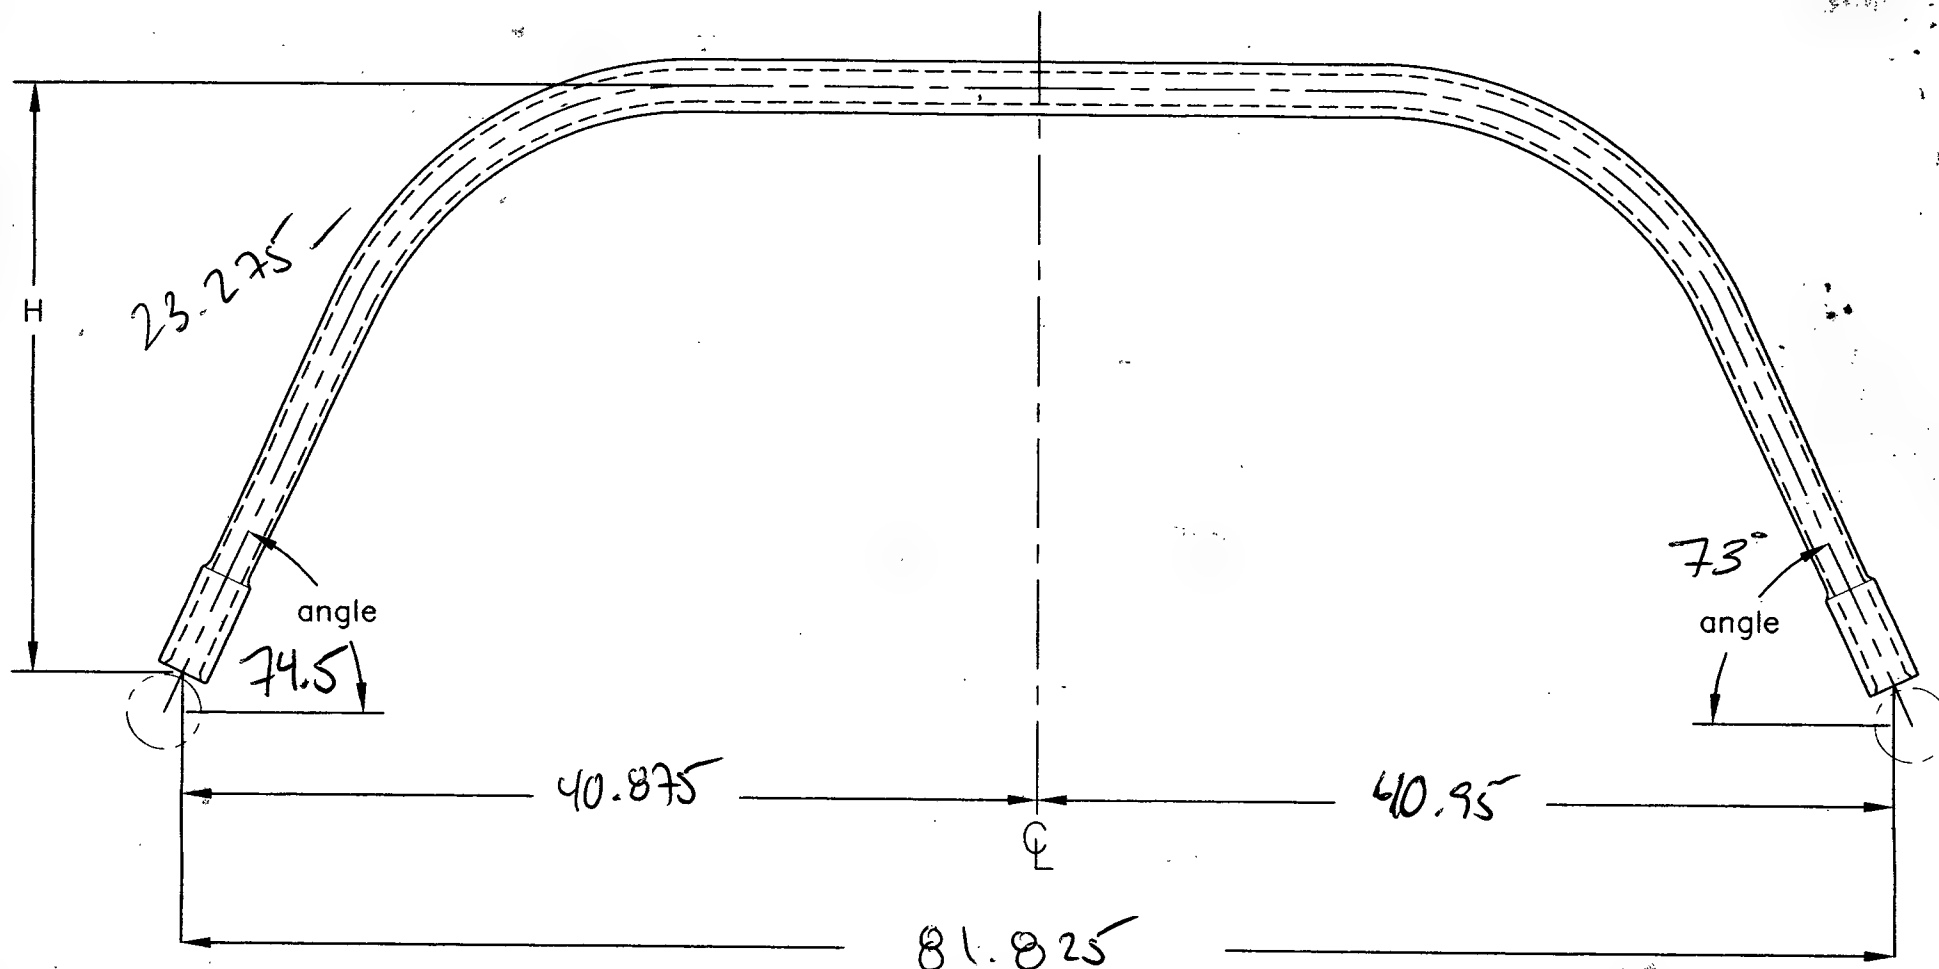

DATE: 06-08-09

DESCRIPTION: 0350-748-141

BATCH NO: 627826A

DRAWING: 350 Prel. Rev. 6

H: 23.25

1/2 SPAN: 40.90 ± .130

TOTAL SPAN: 81.80

ANGLE: 75 ± 2

18 OVER
060907

8125

Chris Provencal

From: S Shahbazian [sshahbazian@dartaero.com]
Sent: August 17, 2006 12:18 PM
To: Provencal, Chris
Subject: FW: 350 fwd Xtube OD variation

FYI

Serge Shahbazian
Design Manager
Dart Aerospace Ltd.
Tel: 613-632-3336

-----Original Message-----

From: David Shepherd [mailto:dshepherd@dartaero.com]
Sent: August 17, 2006 12:07 PM
To: 'S Shahbazian'
Cc: 'Dan Stow'
Subject: RE: 350 fwd Xtube OD variation

D350-748-141 B27825A and B27826A are acceptable to me.

David

-----Original Message-----

From: S Shahbazian [mailto:sshahbazian@dartaero.com]
Sent: Tuesday, August 08, 2006 6:48 AM
To: Shepherd, David
Cc: Provencal, Chris
Subject: FW: 350 fwd Xtube OD variation

More for your review.

Thanks
Serge

-----Original Message-----

From: Dan Stow [mailto:dstow@dartaero.com]
Sent: August 5, 2006 12:10 PM
To: sshahbazian@dartaero.com; Bill Beckett (E-mail)
Cc: chrisp@dartaero.com
Subject: 350 fwd Xtube OD variation

Bill/Serge

Please review and send to David
Thanks Dan

Attached is a photo containing the FAI sheets for the 350 fwd Xtubes
Batches: 27825A and 27826A. In the last two columns renamed Actual Dims and Variance
from DWG Dims are the measurements that I took after they came back from heat treating
and sand blasting. Please note that the dimensions are not the same all the way around
the OD of the tube, the majority of the circumferences of the tubes are within
tolerance but there seems to be a "flat" spot in some places. Are the tubes
acceptable?

Dan

AEROSPACE LTD		Work Order: 27926A
Description: 34 CROSS TUBE 350 FWD		Part Number: D 350-748-141
Inspection Dwg: B	Rev: B	Page 1 of 1

FIRST ARTICLE INSPECTION CHECKLIST

☒ First Article

☐ Prototype

Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
0.062	± 0.010	0.063	—			
4.26	± 0.030	4.270	—			
2.240	± 0.005 -0.000	2.242	—		Good	
2.180	± 0.005 -0.000	2.183	—		Good	
2.180	± 0.005 -0.000	2.185	—		Good	
2.237	± 0.005 -0.000	2.242	—		Good	
2.272	± 0.005 -0.000	2.276	—		Good	
2.306	± 0.005 -0.000	2.310	—		Good	
2.339	± 0.005 -0.000	2.340	—		2.335	-0.004"
2.339	± 0.005 -0.000	2.340	—		Good	
110.27	± 0.060	110.28	—			
0.062	± 0.010	0.063	—		Centre 2.335	Centre 2.339 15-0.004"
4.26	± 0.030	4.280	—			
2.240	± 0.005 -0.000	2.240	—		2.236	-0.004"
2.180	± 0.005 -0.000	2.183	—		2.176	-0.004"
2.180	± 0.005 -0.000	2.184	—		Good	
2.237	± 0.005 -0.000	2.242	—		Good	
2.272	± 0.005 -0.000	2.275	—		Good	
2.306	± 0.005 -0.000	2.309	—		Good	
2.339	± 0.005 -0.000	2.340	—		2.332	-0.007"
2.339	± 0.005 -0.000	2.341	—			

Measured by: <i>Jim</i>	Audited by: <i>SK</i>	Prototype Approval:
Date: 06/07/14	Date: 06.07.16	Date:

Rev	Date	Change	Revised by	Approved
A		New Issue	KJ/JLM	



DESIGN QP	DRAWN BY QP	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED #	APPROVED #	DRAWING NO. D350-748-241	REV. C SHEET 1 OF 3
DATE 06.08.14		TITLE CROSSTUBE (AS 350/355 HI AFT)	SCALE NTS
A	06.03.31	NEW ISSUE	
B	06.06.30	ADD D6018-125 & PRIME AND PAINT	
C	06.08.14	ADD CAD PLATING	

QTY	P/N	DESCRIPTION
X	D350-748-241	CROSSTUBE ASSEMBLY (AS 350/355 HI AFT)
1	D6018-125	CROSSTUBE (OR D6015-125)
2	D3502-1	SUPPORT
2	D2856-400-710	ABRASION STRIP
1	AELS-1032-225	INSERT
1	AN960JD10	WASHER
2	MS21920-20	CLAMP (PER DART SPEC. M-MS21920-20)
1	MS27039-1-10	SCREW

D350-748-141 CROSSTUBE:


- 1) MATERIAL: MANUFACTURED FROM D6018-125 OR D6015-125
FINISHED LENGTH = 122.70 ± 0.06
- 2) MACHINE PER MACHINING DETAIL ON PAGE 3. BLEND OUT ALL EDGES FROM MACHINING LONGITUDINALLY, TRANSITIONS SHOULD BE SMOOTH. NOTE: ALL HOLES ARE DRILLED AFTER BENDING.
- 3) SCRIBE DART PART NUMBER AND BATCH NUMBER IN THIS AREA WITH VIBRATING STYLUS.
- 4) BEND PROGRESSIVELY WITH A MINIMUM OF 7 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D.
- 5) HEAT TREAT TO MIN. 180 KSI PER MIL-T-6736 OR AMS 2759-1C AFTER TURNING
- 6) FINISH: CADMIUM PLATE PER QQ-P-416F, CLASS 1, TYPE II
MAGNETIC PARTICLE INSPECT PER ASTM E1444 AFTER CADMIUM PLATING
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 7) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE. WHEN DRILLING HOLES EXTREME CARE MUST BE TAKEN AND CAREFUL DEBURRING PERFORMED TO ENSURE A CLEAN HOLE WITH NO CRACKING/CHIPPING/GROOVES.
- 8) INSTALL D2856-400-710 ABRASION STRIP WITH A GAP ON BOTTOM SIDE OF CROSSTUBE, CENTERED OPPOSITE D3502-1 SUPPORT, PER QSI 035.
- 9) TORQUE MS21920-20 CLAMPS 60 TO 80 IN-LB
- 10) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 11) ALL DIMENSIONS ARE IN INCHES
- 12) PART IS SYMMETRIC ABOUT CENTERLINE EXCEPT FOR $\varnothing 0.297$ HOLE.

RELEASED

06.08.15 #

Copyright © 2006 by DART AEROSPACE LTD


THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

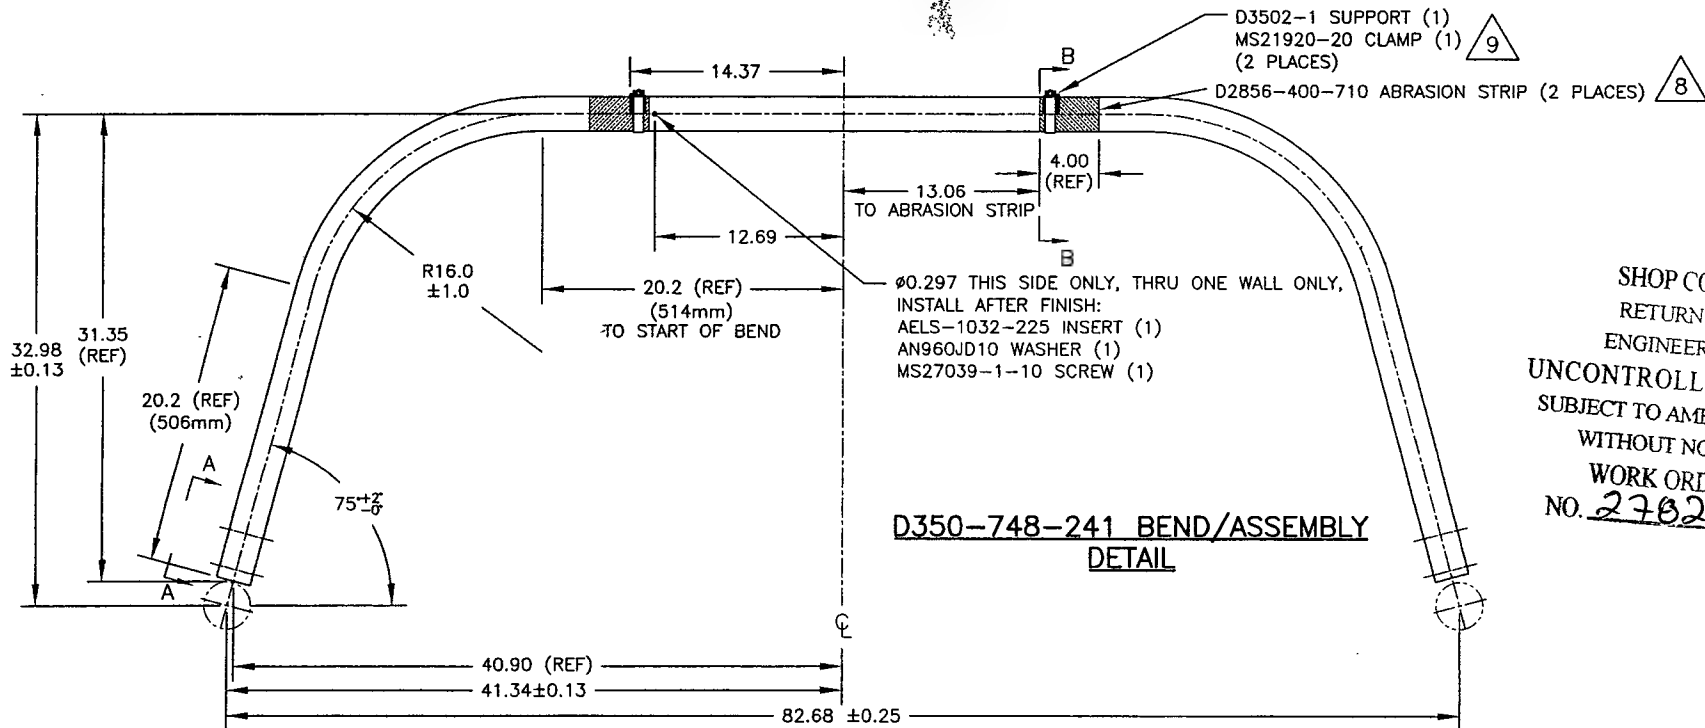

**D350-748-241 BEND/ASSEMBLY
DETAIL**


SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 270264

**SECTION B-B
SCALE 1:2**

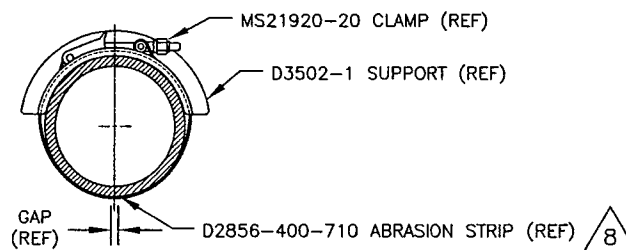

RELEASED

06.08.15

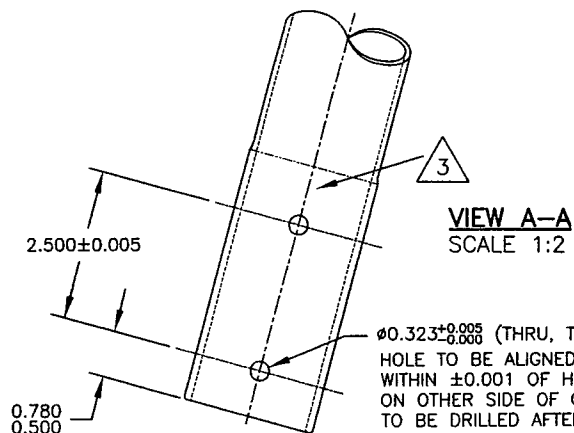


**VIEW A-A
SCALE 1:2**

0.323 ±0.005 (THRU, TYP)
HOLE TO BE ALIGNED
WITHIN ±0.001 OF HOLE
ON OTHER SIDE OF CUFF,
TO BE DRILLED AFTER BENDING

COPYRIGHT © 2008 BY DART AEROSPACE LTD.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL
AND IS SUPPLIED ON THE EXPRESS CONDITION
THAT IT IS NOT TO BE USED FOR ANY PURPOSE
OR COPIED OR COMMUNICATED TO ANY OTHER
PERSON WITHOUT WRITTEN PERMISSION FROM
DART AEROSPACE LTD.

DESIGN	90	DRAWN BY	90	DART	DART AEROSPACE LTD. HAWKESBURY, ONTARIO, CANADA
CHECKED	#	APPROVED	#	DRAWING NO.	REV. C
DATE	06.08.14	TITLE	CROSSTUBE (AS 350/355 HI AFT)	D350-748-241	SHEET 2 OF 3
		SCALE	1:8		

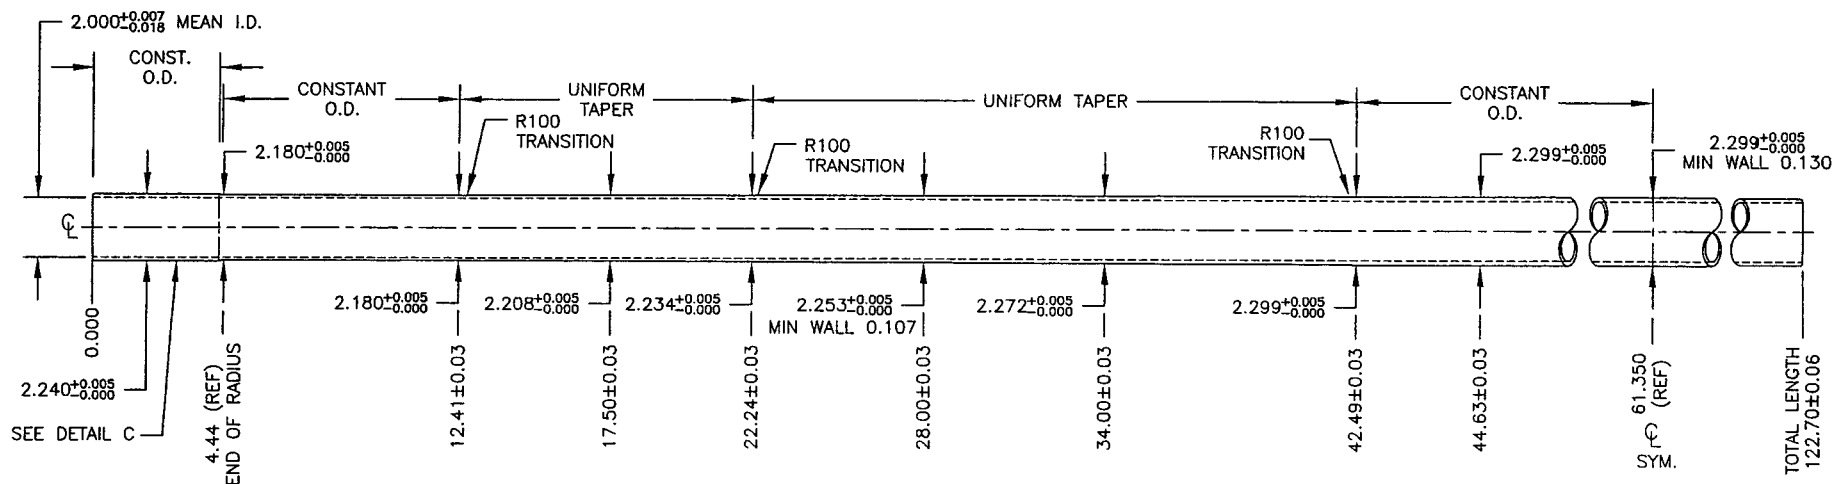


RELEASED

06.08.15


D350-748-241 MACHINING DETAIL

DETAIL C: CUFF
SCALE 1:1

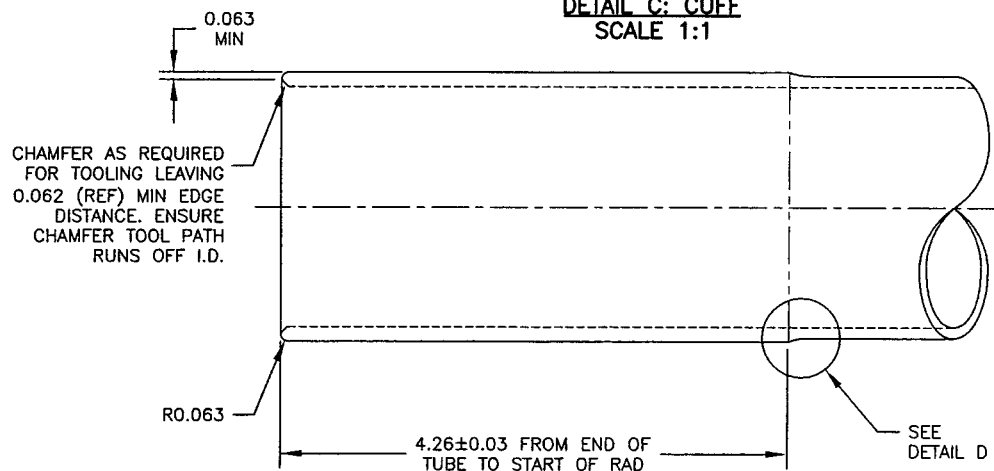

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER NO. 278264

DETAIL D:
CUFF TRANSITION
SCALE 9:1

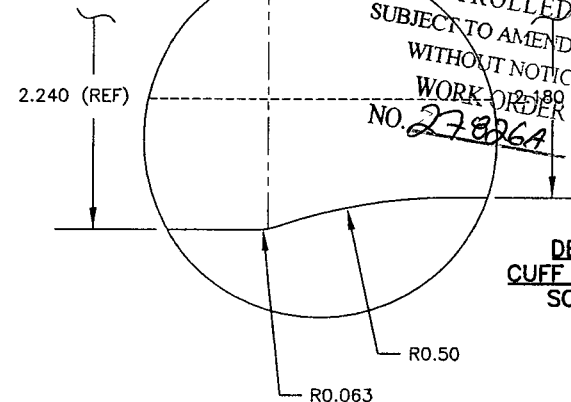

COPYRIGHT © 2008 BY DART AEROSPACE LTD.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

DESIGN	q	DRAWN BY	q	DART	DART AEROSPACE LTD. HAMPSHIRE, ONTARIO, CANADA
CHECKED	#	APPROVED	#	DRAWING NO.	D350-748-241
DATE	06.08.14	TITLE	CROSSTUBE (AS 350/355 HI AFT)	REV. C	SHEET 3 OF 3
				SCALE	1:4

PACKING LIST

PACKING LIST NO: 310991
DATE: 09/22/06

DART AEROSPACE
1270 ABERDEEN STREET
HAWKESBURG ON K6A 1-K7

P.O. NUMBER: 274711

TERMS: C.O.D.

QUANTITY BALANCE PART NUMBER/DESCRIPTION
SHIPPED QTY

1	0	D350-748-141	S/N: B27825A JOB: 542793
1	0	D350-748-141	S/N: B27823A JOB: 542813
1	0	D350-748-141	S/N: B27826A JOB: 542814
1	0	D350-748-241	S/N: B27830A JOB: 542815
1	0	D350-748-241	S/N: B72827A JOB: 542816
1	0	D350-748-241	S/N: B27828A JOB: 542817

1. Stress relieve at 350-400°F for 4 hours minimum
2. Cadmium plate per AMS-QQ-P-416B, Type II, Class 1 (QQ-P-416, Type II, Class 1)
3. Embrittlement relieve within 4 hours of plating at 350-400°F for 8 hours minimum
4. Magnetic particle inspect per ASTM E 1444-05. No linear indications/cracks allowed.

Qty Ins: 6 Qty Rej: 0 Qty Acc: 6

PACKING LIST

PACKING LIST NO: 310991
DATE: 09/22/06

DART AEROSPACE
1270 ABERDEEN STREET
HAWKESBURG ON K6A 1-K7

P.O. NUMBER: 274711

TERMS: C.O.D.

QUANTITY BALANCE PART NUMBER/DESCRIPTION
SHIPPED QTY

5. Inspect

Docn No.:
Ship Via: OTHERS

K



SOUTHWEST

United Industries, Inc.

422 S. ST. LOUIS / TULSA, OK 74120
PHONE 918-587-4161 / FAX 918-582-6158
ACCOUNTING FAX 918-585-2952

CERTIFICATION

CERT NO: 310991
DATE: 09/22/06

DART AEROSPACE
1270 ABERDEEN STREET
HAWKESBURG ON K6A 1-K7

P.O. NUMBER: 274711

R/S

QUANTITY PART NUMBER/DESCRIPTION

1	D350-748-141	S/N: B27825A JOB: 542793
1	D350-748-141	S/N: B27623A JOB: 542813
1	D350-748-141	S/N: B27826A JOB: 542814
1	D350-748-241	S/N: B27830A JOB: 542815
1	D350-748-241	S/N: B72827A JOB: 542816
1	D350-748-241	S/N: B27828A JOB: 542817

1. Stress relieve at 350-400°F for 4 hours minimum
2. Cadmium plate per AMS-QQ-P-416B, Type II, Class 1 (QQ-P-416, Type II, Class 1) ✓
3. Embrittlement relieve within 4 hours of plating at 350-400°F for 8 hours minimum
4. Magnetic particle inspect per ASTM E 1444-05. No linear indications/cracks allowed.

Qty Ins: 6 Qty Rej: 0 Qty Acc: 6

5. Inspect

WE CERTIFY THAT THE PARTS LISTED ABOVE HAVE BEEN PROCESSED IN ACCORDANCE WITH THE REQUIREMENTS AND SPECIFICATIONS OF THE ABOVE REFERENCED PURCHASE ORDER. DOCUMENTATION IS ON FILE AND AVAILABLE FOR REVIEW



Certification

FAA Repair Station CN2R748K

Randy Bruner
Inspector

NOTE: SUBJECT TO SOUTHWEST COMPANIES, INC. STANDARD TERMS & CONDITIONS

INVOICE

DART AEROSPACE
1270 ABERDEEN STREET
HAWKESBURG ON K6A 1-K7

INVOICE NO: 310991
DATE: 09/22/06
SHIP DATE: 09/22/06
P.O. NUMBER: 274711
TERMS: C.O.D.

QUANTITY	PART NUMBER/DESCRIPTION		UNIT PRICE	AMOUNT
1	D350-748-141	S/N: B27825A JOB: 542793	1980.00	1980.00
1	D350-748-141	S/N: B27823A JOB: 542813		
1	D350-748-141	S/N: B27826A JOB: 542814		
1	D350-748-241	S/N: B27830A JOB: 542815		
1	D350-748-241	S/N: B72827A JOB: 542816		
1	D350-748-241	S/N: B27828A JOB: 542817		

1. Stress relieve at 350-400°F for 4 hours minimum
2. Cadmium plate per AMS-QQ-P-416B, Type II, Class 1 (QQ-P-416, Type II, Class 1)
3. Embrittlement relieve within 4 hours of plating at 350-400°F for 8 hours minimum
4. Magnetic particle inspect per ASTM E 1444-05. No linear indications/cracks allowed.

Qty Ins: 6 Qty Rej: 0 Qty Acc: 6

INVOICE

DART AEROSPACE
1270 ABERDEEN STREET
HAWKESBURG ON K6A 1-K7

INVOICE NO: 310991
DATE: 09/22/06
SHIP DATE: 09/22/06
P.O. NUMBER: 274711
TERMS: C.O.D.

QUANTITY PART NUMBER/DESCRIPTION

UNIT PRICE AMOUNT

5. Inspect

Docn No.:
Ship Via: OTHERS

K

Total Amount 1980.00

Chris Provencal

From: David Shepherd [dshepherd@dartaero.com]
Sent: October 3, 2006 10:03 AM
To: 'Chris Provencal'
Cc: 'S Shahbazian'; 'Beckett, Bill'
Subject: RE: 350 xtube cad plating

Chris,

I think the modified CAD plating procedure is acceptable.

As we discussed, I had some concern about the stress relieving comment on the packing slip because I didn't realize that by heating up the tubes, we would be stress relieving them. We didn't test our crosstubes in a stress relieved condition. The crosstubes we tested had compressive stresses in the tensile stress areas of the crosstube. However, because the highest stress areas are in the unbent portion of the crosstube and because I think we had so much margin in our drop test (no shock absorbers, damaged parts, overloaded, etc ...), my gut tells me that we are OK and I don't think we need to re-test.

I'm glad to hear that we are dimensionally checking the crosstubes after all the heating. I think this step should be added to the work order on receiving inspection for every crosstube.

As we discussed, I think a drawing revision is in order. I think reference to a QSI for the procedure outlined on the packing slip would be best.

David

From: Chris Provencal [mailto:cprovencal@dartaero.com]
Sent: Monday, October 02, 2006 2:17 PM
To: David Shepherd (David Shepherd)
Cc: 'S Shahbazian'; 'Bill Beckett (Bill Beckett)'
Subject: 350 xtube cad plating

David,

There is another set of 350 xtubes they want to send out tomorrow. I don't know if you've had a chance to review the cad plating issue. They're eager to get a response.

To recap:

-I originally told you that the magnetic particle was done first. That was the plan, but they ended up following the drawing (cad->magnetic). The invoice I sent you gives the correct order the work was done.

-The cad plating was done to AMS-QQ-P-416B (issued 2004 by SAE) instead of the drawing's' QQ-P-416F (issued 1991 by military). I don't see a problem with this since it's a more current issue, and the only reason we specified QQ-P-416F is because that's what the "old" never-used supplier suggested.

-The dims were re-checked after cad plating and the dimensions did not change.

-An NCR has been created to address the problem with the work orders. The bigger issue is that one was sent to a customer and we need to take action on that one asap.

If you need more info, let me know.

03/10/2006

Chris Provencal

From: David Shepherd [dshepherd@dartaero.com]
Sent: October 3, 2006 10:03 AM
To: 'Chris Provencal'
Subject: RE: NCR D350-748-141 (another)

Acceptable deviation. There is no concern about the grounding wire. From what I saw, there is more than enough slack in the system.

David

From: Chris Provencal [mailto:cprovencal@dartaero.com]
Sent: Monday, October 02, 2006 2:29 PM
To: David Shepherd (David Shepherd)
Subject: NCR D350-748-141 (another)

This is a different issue from the cad plating.

For one D350-748-141 crosstube, the hole for the grounding wire is 0.090" further inboard (towards the center of the crosstube). This crosstube was drilled by hand before they created their drill jig. The error was caught when they rechecked the crosstube to the tooling.

The only problem I see with this is the remote chance the grounding wire isn't long enough, which is more of a risk on Dart (potential return) and not a safety issue.

-Chris

--
No virus found in this incoming message.
Checked by AVG Free Edition.
Version: 7.1.407 / Virus Database: 268.12.11/460 - Release Date: 10/1/2006

--
No virus found in this outgoing message.
Checked by AVG Free Edition.
Version: 7.1.407 / Virus Database: 268.12.11/460 - Release Date: 10/1/2006

03/10/2006

